




**Add iPod Capability to
Your Factory Radio**

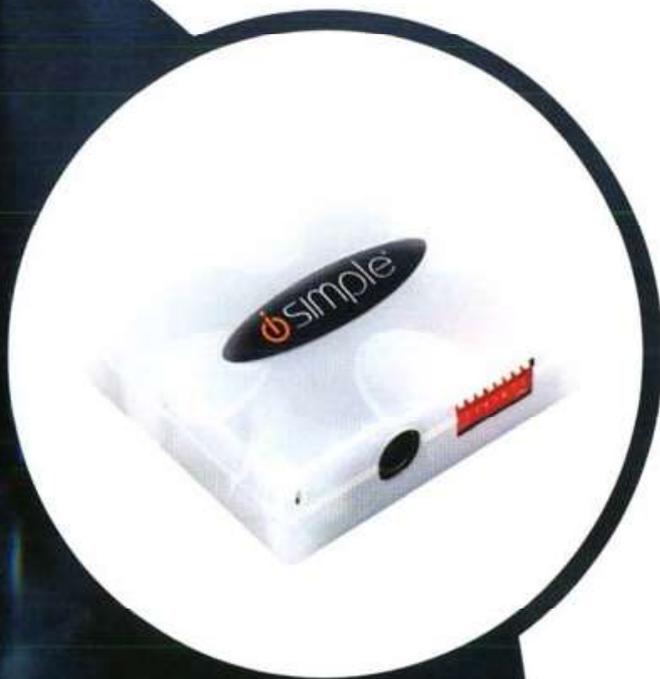

**Owner's
Manual
PXDP
SoundByte**

iSimple Solutions®,
A division of AAMP of America™
13160 56th Court Clearwater, Florida 33760
Ph. 866-788-4237
support@isimplesolutions.com
©2009 AAMP of Florida, Inc.

11-19-09

Table of Contents

| | Pages |
|---|--------------|
| CHAPTER 1-Getting Started | |
| 1.1 Introduction | 4 |
| 1.2 Precautions | 4 |
| 1.3 Configuration & Harnesses | 5 |
| 1.4 Programming the PXDP | 6 |
| | |
| CHAPTER 2-General Installation | |
| 2.1 Installation Location | 7 |
| 2.2 Pre-Installation Checklist | 8 |
| 2.3 Wiring Connections | 8 |
| 2.4 Installation at Changer Location | 10 |
| 2.5 Installation at Radio | 11 |
| | |
| CHAPTER 3 -Operation | |
| 3.1 Operation | 13 |
| 3.2 Troubleshooting | 15 |
| 3.3 Warranty | 16 |
| 3.4 Warning | 16 |
| 3.5 FCC Statement | 17 |
| | |
| Dipswitch Settings & Harness Guide | 18 |


PXDP Connections



Factory Radio
(not included)



Vehicle Specific Harness
(actual harness may vary)

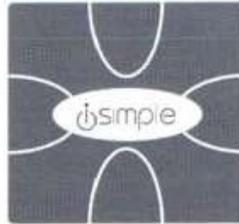

PXDP Interface



iPod Input

Chapter 1- Getting Started

1.1 Introduction

Thank you for purchasing the PXDP iPod Interface, by iSimple®. The PXDP is designed to provide endless hours of listening pleasure through most vehicles' factory radios. To ensure that your iPod performs correctly in your car or truck, we recommend that you read this entire manual before attempting installation of the PXDP interface.

The PXDP interface will allow you to connect your iPod to a factory radio that has the ability to control a CD changer. The PXDP is designed to be used with most iPod Models featuring the 30 pin docking port.

1.2 Precautions (Important, Please Read)

UPDATING iPod FIRMWARE

For proper operation of the PXDP, your iPod must be updated with the most recent version of Firmware from Apple. This is done on your computer. To Update the software on the iPod go to <http://www.apple.com/ipod/download/>. Follow the directions on the website to complete the download. There is no charge for this update.

PREVENTING DAMAGE TO YOUR VEHICLE OR iPod.

The manufacturer recommends unplugging the iPod when not in use. To eliminate the risk of an electrical short, we recommend disconnecting the car battery in most vehicles, prior to installation except in the following situations:


- Vehicles equipped with on-board navigation should not have the car's battery disconnected. Doing so may cause loss of memory settings. These settings would then have to be reprogrammed by an authorized car dealer for a fee to be paid by the vehicle's owner. For these vehicles, we recommend extreme caution when handling exposed 12V power or ground wires/connectors.

•Vehicles that incorporate a security-code protecting the radio. If the car's battery or the radio's power plugs are disconnected, the radio will not operate without re-entering the security-code. If you have access to the security-code, feel comfortable disconnecting the battery and the radio's power connectors. Otherwise, do not disconnect the battery and exercise extreme caution while handling exposed 12V power or ground wires/connectors.


PROPER MOUNTING LOCATION

Securely install the interface in a location free from; heat, humidity, moving parts or direct sunlight. Beware of hot-air flow from your vehicle's climate control system. We recommend securing the interface to a suitable location, free of sharp metal edges, using; double sided tape, Velcro or wire ties.


PXDP Interface

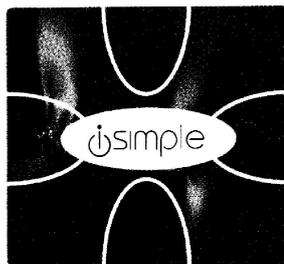

Docking Cable

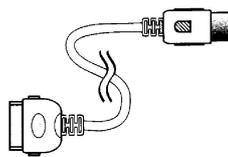

Vehicle Specific Harness

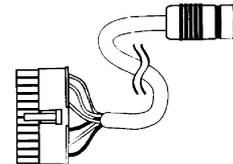

1.3 Configuration and Harness Selection

This section will instruct you on how to properly identify and/or confirm the proper interface dip-switch configuration and vehicle specific harness selection.

Use the guide located in the back of this manual on page 18 to locate your vehicle, inform you of the proper dip-switch configuration for the interface, and the vehicle specific harness that you will need for your particular vehicle.


Depending on the type of PXDP kit you purchased, it might include a bundle of different vehicle harnesses or none at all. If the kit contains many harnesses, only one will be needed for your specific vehicle. If the kit came without any vehicle harness, your authorized iSimple® dealer will have the harness for you to purchase separately.

As you consult the application guide, please take a moment to review our IMPORTANT COMPATIBILITY NOTES listed with each of the vehicle manufacturers. These notes will inform you of any issues or circumstances that can affect the compatibility of our product with your factory audio system and accessories. Some situations result in the loss of use of some factory audio players. Please read and understand these notes before proceeding with the installation.

1.6 Programming the PXDP

Now that you have identified the correct harness and dip-switch configuration using the application guide, it is now time to program the interface. To program the interface, set the dip-switches located on the side of the interface (see Fig.1 below) to the configuration listed for your vehicle in the application guide. Switches are in their default setting of “off” in the up position and are turned “on” when switched down. This programs the PXDP to work with the vehicle in which it will be installed. The dip-switches **MUST be set before the interface is plugged into the vehicle**. Otherwise the PXDP will not work correctly.

Fig.1 Side view of Interface with dip switches

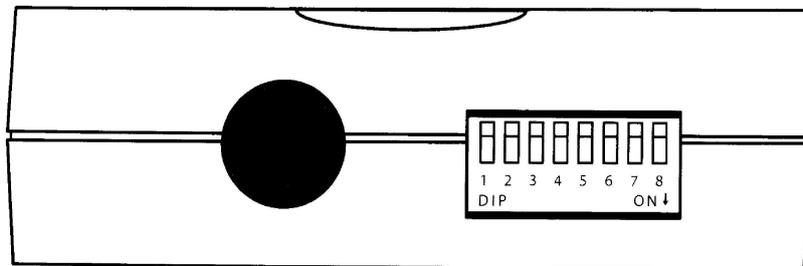


Please Refer to Page 18 for Configuration Settings

Chapter 2- General Installation

2.1 Installation Location

Most installations will require you to remove the factory radio in order to plug in the vehicle specific harness. Some vehicles may require you to connect the interface to a factory pre-run CD changer cable. The location of these CD changer cables will vary by vehicle. Some common locations of these cables are in the trunk, behind the glove box, and in or under a center console. (see Fig.2 below)

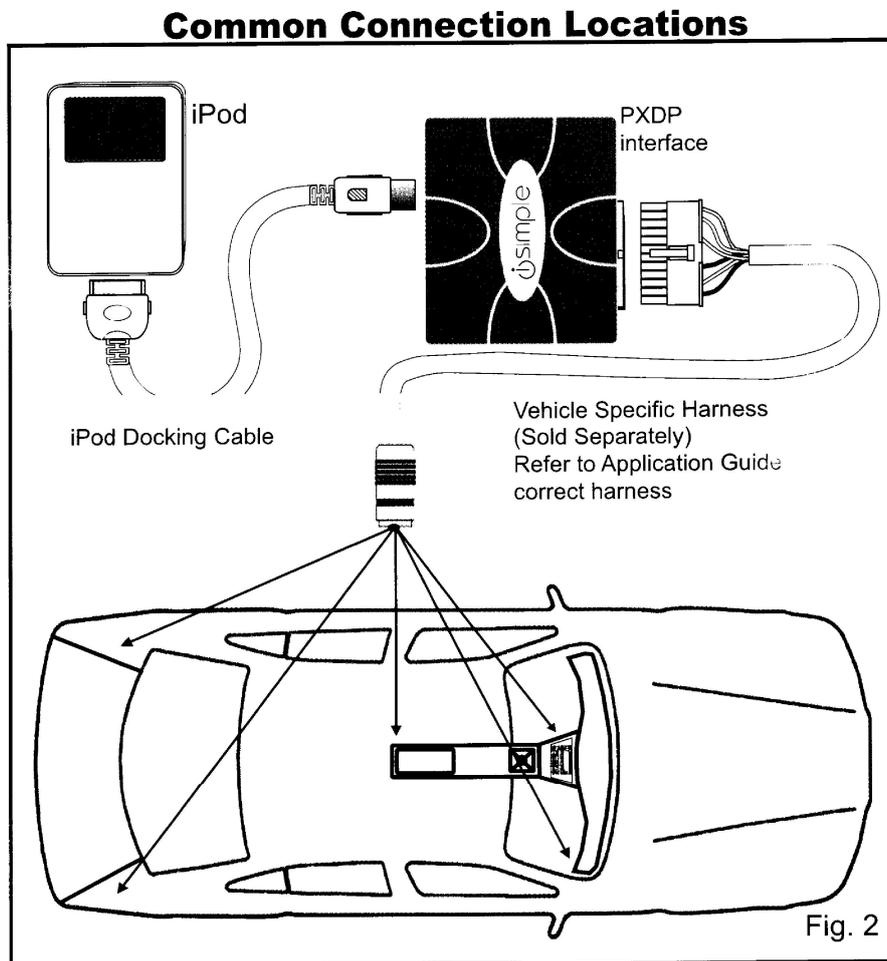

2.2 Pre-Installation Checklist

At this time and before beginning the installation please ensure that:

- **You have read and understand the precautions outlined in section 1.2**
- **Your iPod's Firmware is up to date. (section 1.2)**
- **You have your radio's security code.(when applicable, see section 1.2)**
- **The dip-switches on the interface have been set with the proper configuration. (see section 1.3)**
- **You have in your possession the correct harness for your vehicle. (see sec. 1.3)**
- **You have determined your installation location. (see section 2.1)**

If any of these steps has not been taken, STOP. Only when ALL of these steps have been taken should you proceed with the rest of the installation.

2.3 Wiring Connections

Some vehicle specific harnesses require wiring connections that involve splicing of wires. If you are not confident in making these connections to your radio's wiring harness, we recommend you seek professional installation. You can visit www.isimplesolutions.com and click on the dealer link at the top of the page to find an authorized professional installer.

Make these connections only after verifying the proper circuit on your radio harness with a voltmeter. With the key OFF and the negative test lead of the voltmeter firmly touching a bare metal chassis part of your car, begin probing the wires in the main radio harness with the positive test lead. The constant 12V+ circuit should read a continuous 12 volts or higher.

Once you've identified the constant 12V+ circuit, strip back about 1/8" of the insulation. Now take the positive test lead and insert it into the wire stranding so that you can now probe for a suitable ground location in the dash cavity using the negative test lead. Bare chassis metal is the recommended ground spot. The voltmeter will read a constant 12 volts or higher when you have found a good ground point. Attach the BLACK ground wire to this spot with either an existing bolt or screw or use a metal piercing screw. You also have the option of splicing into the ground wire in the main radio harness. Probe the remaining wires with the negative test lead until you again find a circuit that reads a constant 12 volts on the voltmeter. When you've found a circuit that reads constant 12 volts, turn the dash light dimmer control to make sure you have not probed the illumination dimmer circuit. If the circuit continues to read a constant 12 volts or higher regardless of the dimmer position, you have found the ground wire. If not, continue testing until you do. Some vehicles do not have a ground wire in their main radio harness and instead ground through their mounting brackets to the dash. In these cases, you will have to ground the black wire to the bare metal chassis inside the dash . Once the ground wire is connected, please finish your wiring connections by splicing in the external YELLOW wire from the vehicle specific harness.

Vehicle Specific Harnesses that require wiring connections:

PXHFD1 – connect the Yellow wire to constant 12V+ & connect the Black wire to ground.

PXHFD2 – connect the Yellow wire to constant 12V+ & connect the Black wire to ground.

PXHFD3 – connect the Yellow wire to constant 12V+ & connect the Black wire to ground.

PXHGM3 – connect the Yellow wire to constant 12V+ & connect the Black wire to ground.

PXHVW2 – connect both the Black and Black/White wires to ground.

2.4 Installation at the CD Changer Location

In this section you will learn how to install the PXDP in the factory CD changer location. If your vehicle is equipped with a factory CD changer you will need to disconnect it from the factory pre-run harness in order to connect the PXDP interface. If your vehicle is not equipped with a factory CD changer, you will need to locate the factory pre-run harness. This may involve the removal of the; center console, glove box, or carpeted side panels in the trunk. Please consult your vehicle's dealership or a local car audio professional for instruction or assistance with locating the factory CD changer connection if necessary.

1. Connect your vehicle specific Harness to the factory pre-run CD changer harness in the vehicle.
2. Make any necessary wiring connections on your vehicle specific harness. Please see section 2.3 for details on making these wiring connections.
3. Now that the interface is connected to the radio, you will need to test the operation of the interface before permanently running the black iPod docking cable or re-assembling the dash.

First, connect the black iPod cable to the iPod. The iPod should indicate that it is being charged. Turn on the factory radio and press the button that would activate the factory CD changer to select the iPod. It may take up to three minutes for the interface to initialize to the radio (this only happens the very first time you select the iPod). Once the iPod has been selected, press Play on the iPod. You should be able to hear the music on your iPod through your factory radio. Now press the "Next Track" button on the radio. The iPod should change to the next song on the iPod. By pressing the "Previous Track" button on the radio the iPod should change to the previous song. With the operation of the interface confirmed, you may continue with the installation. If you experience difficulties in operation, please see our troubleshooting chart in section 3.2.

4. Decide on a convenient location to mount your iPod.
5. Run the docking cable from the interface to the desired mounting location. Use caution to not cut, pinch, or crimp the cable during this step. Avoid moving parts, vehicle wiring harnesses and areas of excessive heat when routing the cable.
6. Secure the interface in the vehicle using; double sided tape, Velcro or wire ties. Make sure to check for proper clearance and avoid moving parts. Take into account the size of the interface and the wire harness and do not force the interface and harness into a space that is too tight, damage to the harness may result.
7. Now that the interface is secured and the docking cable has been run, you are ready to enjoy your iPod in your vehicle!

2.5 Installation at the Radio

In this section you will learn how to install the PXDP behind the radio. If your vehicle is equipped with a factory CD changer or other external audio source, you will need to disconnect it from the back of the radio in order to connect the PXDP interface.

1. Carefully remove the radio from the vehicle. If your radio uses a Security Code, make sure that you have the code before unplugging the radio. Some vehicles require the use of special tools to remove the radio. Please consult your vehicle's dealership or a local car audio professional for instruction or assistance with radio removal if necessary.
2. Make any necessary wiring connections on your vehicle specific harness. Please see section 2.3 for details on making these wiring connections.
3. Connect the Vehicle Specific Harness to the CD changer port on the back of the radio. Be sure to make a firm connection but do not force it. If there is difficulty making the connection, please consult the application guide to confirm your vehicle specific harness selection.

4. Now that the interface is connected to the radio, you will need to test the operation of the interface before permanently running the black iPod docking cable or re-assembling the dash.

First, connect the black iPod cable to the iPod. The iPod should indicate that it is being charged. Turn on the factory radio and press the button that would activate the factory CD changer to select the iPod. It may take up to three minutes for the interface to initialize to the radio (this only happens the very first time you select the iPod). Once the iPod has been selected, press Play on the iPod. You should be able to hear the music on your iPod through your factory radio. Now press the "Next Track" button on the radio. The iPod should change to the next song on the iPod. By pressing the "Previous Track" button on the radio the iPod should change to the previous song. With the operation of the interface confirmed, you may continue with the installation. If you experience difficulties in operation, please see our troubleshooting chart in section 3.2.

5. Decide on a convenient location to mount your iPod.

6. Run the docking cable from the interface to the desired mounting location. Use caution to not cut, pinch, or crimp the cable during this step. Avoid moving parts, vehicle wiring harnesses and areas of excessive heat when routing the cable.

7. Secure the interface in the dash cavity behind the radio using; double sided tape, Velcro or wire ties. Make sure to check for proper clearance and avoid moving parts. Take into account the size of the interface and the wire harness and do not force the interface and harness into a space that is too tight, damage to the harness may result.

8. Now that the interface is secured and the docking cable has been run, you may reinstall the radio and replace any panels that may have been removed to access the radio. You are ready to enjoy your iPod in your vehicle!

Chapter 3- Operation

3.1 Operation

SELECTING THE IPOD

To select the iPod from the radio, press the button that would normally activate the factory CD changer. This button varies by vehicle manufacturers. In some applications the PXDP is accessed like an XM receiver, in these cases you will press the appropriate activation button. Some radio models require pressing the “Seek >” button once, after pressing the CD button. Yet, it may also be necessary to press Play on the iPod itself to begin playback. In some cases, if it is the first time selecting the iPod from the radio it may take up to three minutes for the PXDP to initialize.

CONTROLLING THE IPOD FROM THE RADIO

With the PXDP interface, the radio will control the iPod as if it were a factory CD changer. Therefore, operation will be done by using the same buttons you would use to control a factory CD changer. For more details on your particular radio, consult your vehicle’s owner’s manual.

The PXDP interface allows you to skip songs forward and backwards and also to fast forward and rewind through a particular song. In general, most radios will utilize “seek” or “track” buttons to control these functions.

CONTROLLING THE IPOD FROM THE IPOD

The PXDP interface allows you to keep full control of the iPod from the click wheel. You can browse files and change playlist on the iPod. You can also skip songs forward and backwards from the iPod. The PXDP interface does not disable any functionality of the iPod!

RADIO DISPLAY DURING IPOD OPERATION

Some factory radio's may show DISC and TRACK numbers on the display of the radio. The PXDP interface does not send any information from the iPod to the radio. This means that the DISC and TRACK numbers shown on the display will not and can not reflect the song number on the iPod due to the complex nature of the music library. Some factory radio's may flash zero's on the display of the radio, or toggle back and forth between 1:00 and 2:00. All these are normal behaviors and do not represent a malfunction.

CONTROLLING THE IPOD FROM THE STEERING WHEEL CONTROLS

If your vehicle's steering wheel controls have the ability to select track and control the forward and rewind functions of your factory CD changer, then they will also control these same functions on the iPod.

3.2 Troubleshooting

| Symptom | Cause | Remedy |
|--|---|---|
| No Power | Blown fuse in vehicle fuse block. | Replace fuse with same amp rating. If the fuse blows again, call tech support. |
| No Power | Bad connection. | Check cable and wiring connection. |
| Alternator noise is heard (Changes with Engine RPM) | Improper wiring creates a ground loop. | Install a Ground loop isolator or seek professional service from a local car audio shop. |
| You can hear music from the iPod but you cant control it from the radio. | The Firmware on the iPod may not be updated. | Update the Firmware on the iPod. See section 1.2 of this manual. |
| Radio is not recognizing PXDP interface | Bad cables or cables are not connected properly between converter box and car radio. | Check connection and cables, push in firmly. |
| Radio is not recognizing PXDP interface | Wrong configuration on the interface. | Select the right pconfiguration for your car. (See section 1.3). |
| Radio is not recognizing PXDP interface | Yellow and black wires are not connected to Constant 12V+ and Ground. (When applicable). | Please read wiring instructions in chapter 2 of this manual and see if your car requires to connect the yellow and black cable to power and ground. |
| iPod Audio is Low or Distorted | PXDP interface is connected with an external CD changer or other external factory audio source. | Disconnect the factory external audio source. |
| iPod is not charging | Yellow and black wires are not connected to Constant 12V+ and Ground. (When applicable). | Please read your vehicles section in this manual and see if your car requires to connect the yellow and black cable to power and ground. |

3.3 Warranty

One Year Limited Warranty

The quality controls used in the manufacture of this product This warranty covers any supplied or manufactured parts of this product that, upon inspection by iSimple authorized personnel, is found to have failed in normal use due to defects in material or workmanship. This warranty does not apply to installation expenses.

Attempting to service or modify this unit, operating this unit under conditions other than the recommended voltage will render this WARRANTY VOID.

Unless otherwise prescribed by law, iSimple shall not be liable for any personal injury, property damage and or any incidental or consequential damages of any kind (including water damage) resulting from malfunctions, defects, misuse, improper installation or alteration of this product.

All parts of this iSimple product are guaranteed for a period of 1 year as follows:

Within the first 12 months from date of purchase, subject to the conditions above, iSimple will repair or replace the product at their discretion, if it is defective in material or workmanship providing it is returned to an Authorized iSimple's Dealer, with PROOF OF PURCHASE from an authorized iSimple dealer.

3.4 Warning

This equipment may be reset by unintentional electrostatic discharge during operation. Exposure to direct sunlight or extreme heat may cause damage or malfunction.

3.5 FCC Class B Radio Frequency Interference Statement

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of FCC rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

1. Reorientate or relocate the receiving antenna.
2. Increase the separation between the equipment and receiver.
3. Connect the equipment into an outlet on a circuit different from that of which the receiver is connected.
4. Consult the dealer or an experienced radio / television technical for help

Notice : The changes or modifications not expressly approved by the party responsible for compliance could void the user authority to operate the equipment.

Dipswitch Settings & Harness Applications

| Make | Model | Year | Part # | Harness | Dip Switch Settings** | Vehicle Specific Notes |
|--|---------------------------|-----------|----------|-----------------|---|---|
| Acura | CL | 1998-2000 | PXDP | PXHH1 | 1,4,8 ON | |
| | CL | 1996-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Integra | 1998-2001 | PXDP | PXHH1 | 1,4,8 ON | |
| | Integra | 1992-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Legend | 1992-1995 | PXDP | PXHCH2 | 1,4,8 ON | |
| | RL | 1998-2002 | PXDP | PXHH1 | 1,4,8 ON | |
| | RL | 1996-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | RSX | 2002 | PXDP | PXHH1 | 1,4,8 ON | |
| | TL | 1999-2002 | PXDP | PXHH1 | 1,4,8 ON | |
| | TL | 1996-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Vigor | 1992-1994 | PXDP | PXHCH2 | 1,4,8 ON | |
| | All Models | 2003-2007 | | | | |
| | MDX | All Years | | | | |
| | SLX | All Years | | | | |
| | NSX | All Years | | | | |
| IMPORTANT ACURA APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with factory radios that have an in dash 6 disk cd changer. Not compatible with navigation radios. | | | | | | |
| Audi | All Models (Except Below) | 1998-2004 | PXDP | PXHAD1 | 1,8 ON | |
| | All Models (Except Below) | 1998-2004 | PXDP | PXHAD2 + PXHW2* | 1,8 ON | Connect at pre-wired 13-pin cable in the left rear trunk. |
| IMPORTANT AUDI APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Vehicles with Symphony sound systems must use special adapter harness PXHAD2 as well as PXHW2 and connect at radio. | | | | | | |
| BMW | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| | 3 Series | 1996-2005 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| | 5 Series | 1996-2005 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| | 7 Series | 1999-2001 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| | Mini | 2001-2006 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| | X5 | 1999-2005 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| | Z3/Z5 | 1998-2003 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location |
| Z4 | 2003-2005 | ISBM72 | Included | 3,4,8 ON | Not Compatible with DSP radios, Trunk Mounting Location | |
| IMPORTANT BMW APPLICATION INFORMATION | | | | | | |
| ISBM71: Not Compatible with Factory Head Units with DSP. *DSP* will be indicated on a radio button. Not compatible with vehicles equipped with iDrive. | | | | | | |
| **Dip Switch Settings: Please See Product Instructions for Dip Switch Configuration Settings | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
|--|---|-----------|----------------|-----------------|----------------------|--|--|
| Buick | Century | 1997-2003 | PXDP | PXHGM1 & GMH32T | 3.8 ON | Must use GMH32T T-harness then plug *PXHGM1 behind radio. Must use GMH32T T-harness then plug *PXHGM1 behind radio. | |
| | Le Sabre | 1999-2002 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Park Ave | 1995-2005 | PXDP | PXHGM1 & GMH32T | 3.8 ON | | |
| | Reinier | 2005 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Regal | 1995-2003 | PXDP | PXHGM1 & GMH32T | 3.8 ON | | |
| | Rendezvous | 2003-2005 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Riviera | 1996-1999 | PXDP | PXHGM1 & GMH32T | 3.8 ON | | |
| | Roadmaster | 1995-1996 | PXDP | PXHGM1 & GMH32T | 3.8 ON | | |
| | Allure | 2005 | Not Compatible | | | | |
| | LaCrosse | 2005 | Not Compatible | | | | |
| IMPORTANT BUICK APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PXDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripherals/electronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | | |
| Cadillac | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Catera | 2001 | PXDP | PXHGM2 | 3.8 ON | Behind radio or Trunk Mounting Location | |
| | Deville | 1995-2003 | PXDP | PXHGM2 | 3.8 ON or 1,3.8 ON | Behind radio or Trunk Mounting Location | |
| | El Dorado | 1995-2002 | PXDP | PXHGM2 | 3.8 ON | Trunk Mounting Location | |
| | Escalade | 1999-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Escalade | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON or 2,3.8 ON | | |
| | Saville | 1995-2005 | PXDP | PXHGM2 | 3.8 ON | | |
| IMPORTANT CADILLAC APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PXDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripherals/electronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | | |
| Chevrolet | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Astro Van | 1996-2005 | PXDP | PXHGM1 | 3.8 ON | | |
| | Avalanche | 2002 | PXD | PXHGM1 | 3.8 ON | | |
| | Avalanche | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Blazer | 1998-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Camaro | 1997-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Cavalier | 1996-1999 | PXDP | PXHGM1 | 3.8 ON | | |
| | Cavalier | 2003-2005 | PXDP | PXHGM3 | 1,3.8 ON or 2,3.8 ON | | |
| | Colorado | 2005 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Corvette | 1997-2004 | PXDP | PXHGM2 | 3.8 ON | | |
| | Corvette | 1997-2004 | PXDP | PXHGM4 | 3.8 ON | | |
| | Impala | 1995-1999 | PXDP | PXHGM1 | 3.8 ON | | |
| | Impala | 2000-2005 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Lumina | 1996-1999 | PXDP | PXHGM1 | 3.8 ON | | |
| | Malibu | 1997-2000 | PXDP | PXHGM1 | 3.8 ON | | |
| | Monte Carlo | 1995-1999 | PXDP | PXHGM1 | 3.8 ON | | |
| | As a substitute, Can also use PXHGM1 and GMH20T Harnesses | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
|--|---|------------|--------|---------|----------------------|---|
| Chevrolet | Monte Carlo | 2000-2005 | PXDP | PXHG3 | 3,8 ON | |
| | Silverado | 1996-2002 | PXDP | PXGM1 | 3,8 ON | |
| | Silverado | 2003-2006 | PXDP | PXGM3 | 1,3,8 ON | |
| | Suburban | 1995-2002 | PXDP | PXGM1 | 3,8 ON | |
| | Suburban | 2003-2006 | PXDP | PXGM3 | 1,3,8 ON | |
| | Tahoe | 1995-2002 | PXDP | PXGM1 | 3,8 ON | |
| | Tahoe | 2003-2006 | PXDP | PXGM3 | 1,3,8 ON | |
| | Trailblazer | 2002-2007 | PXDP | PXGM3 | 1,3,8 ON or 2,3,8 ON | |
| | Venture | 1997-1999 | PXDP | PXGM1 | 3,8 ON | |
| | Venture | 2004-2005 | PXDP | PXGM3 | 1,3,8 ON or 2,3,8 ON | |
| IMPORTANT CHEVROLET APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PXDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripherals/electronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player. (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | |
| Chrysler | All Models | 2002-2005 | PXDP | PXCH3 | 4,8 ON | Must be non-CANBUS, if radio is an REF, REC, RAO, RAK series, vehicles are not compatible |
| | All Models | 1999--2001 | PXDP | PXCH2 | 4,8 ON | *1999 Radios with rounded corners use PXCH2 |
| | All Models | 1995-1999* | PXDP | PXCH1 | 1,4,8 ON | *1999 Radios with square corners use PXCH1 |
| | Pacifica | 2006 | PXDP | PXCH3 | 4,8 ON | |
| | Sebring | 2006 | PXDP | PXCH3 | 4,8 ON | |
| | IMPORTANT CHRYSLER APPLICATION INFORMATION | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. To determine if your 2002-2005 vehicle is compatible, factory radio must have "Disk ^" on preset 1. Vehicle must be non-CANBUS, if radio is an REF, REC, RAO, RAK series, vehicles are not compatible. The series is indicated on the front of the radio. 1999 Chrysler vehicles have one of two different style radios. These two radios use different harnesses. The shape of the radio face will determine which harness you will use. If your radio face is SQUARE, you will use the harness part# PXCH1. If your radio face is OVAL (rounded corners), you will use the harness part# PXCH2. | | | | | | |
| Dodge | All Models | 2002-2005 | PXDP | PXCH3 | 4,8 ON | Must be non-CANBUS, if radio is an REF, REC, RAO, RAK series, vehicles are not compatible |
| | All Models | 1999*-2001 | PXDP | PXCH2 | 4,8 ON | *1999 Radios with rounded corners use PXCH2 |
| | All Models | 1995-1999* | PXDP | PXCH1 | 1,4,8 ON | *1999 Radios with square corners use PXCH1 |
| IMPORTANT DODGE APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. To determine if your 2002-2005 vehicle is compatible, factory radio must have "Disk ^" on preset 1. Vehicle must be non-CANBUS, if radio is an REF, REC, RAO, RAK series, vehicles are not compatible. The series is indicated on the front of the radio. 1999 Chrysler vehicles have one of two different style radios. These two radios use different harnesses. The shape of the radio face will determine which harness you will use. If your radio face is SQUARE, you will use the harness part# PXCH1. If your radio face is OVAL (rounded corners), you will use the harness part# PXCH2. | | | | | | |
| Eagle | All Models | 1995-1998 | PXDP | PXCH1 | 1,4,8 ON | All models must have "Disc ^" printed on Preset Button # 1. |
| | IMPORTANT EAGLE APPLICATION INFORMATION | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. If your vehicle is equipped with a factory CD changer, you must disconnect it in order to be able to install the interface. You will lose the use of the factory CD changer to gain use of your iPod. | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
|--|--|-----------|--------|---------|----------------------|--|--|
| Ford | Crown Victoria | 1998-2003 | PXDP | PXHFD3 | 2.8 ON | | |
| | Crown Victoria | 1995-1997 | PXDP | PXHFD2 | 2.8 ON | | |
| | Crown Victoria | 1995-1997 | PXDP | PXHFD1 | 2.8 ON | | |
| | Escape | 2001-2004 | PXDP | PXHFD3 | 2.8 ON | *If equipped with JBL, use PX-HFD1 at Rear Control Unit in trunk | |
| | Ecoroline | 1998-2004 | PXDP | PXHFD3 | 2.8 ON | | |
| | Ecoroline | 1997 | PXDP | PXHFD2 | 2.8 ON | | |
| | Escort | 1997-2004 | PXDP | PXHFD2 | 2.8 ON | | |
| | Excursion | 2000-2004 | PXDP | PXHFD3 | 2.8 ON | | |
| | Expedition | 1999-2002 | PXDP | PXHFD3 | 2.8 ON | | |
| | Expedition | 1997-1998 | PXDP | PXHFD2 | 2.8 ON | | |
| | Explorer | 1998-2004 | PXDP | PXHFD3 | 2.8 ON | | |
| | Explorer | 1995-1997 | PXDP | PXHFD2 | 2.8 ON | | |
| | Explorer | 1995-1997 | PXDP | PXHFD1 | 2.8 ON | | |
| | Freestar | 2004 | PXDP | PXHFD3 | 2.8 ON | *If equipped with JBL, use PX-HFD1 at Rear Control Unit in trunk | |
| | F-series Pick Up | 1998-2003 | PXDP | PXHFD3 | 2.8 ON | | |
| | F-series Pick Up | 1995-1997 | PXDP | PXHFD2 | 2.8 ON | | |
| | Focus | 2000-2003 | PXDP | PXHFD4 | 2.8 ON | | |
| | Mustang | 2001-2003 | PXDP | PXHFD3 | 2.8 ON | | |
| | Ranger | 1998-2004 | PXDP | PXHFD3 | 2.8 ON | Not compatible with factory installed Blaupunkt radio | |
| | Ranger | 1995-1997 | PXDP | PXHFD2 | 2.8 ON | | |
| | Sport Trac | 2000-2004 | PXDP | PXHFD3 | 2.8 ON | | |
| | Taurus | 1996-2005 | PXDP | PXHFD1 | 2.8 ON | | |
| | Thunderbird | 2000-2004 | PXDP | PXHFD3 | 2.8 ON | Trunk Mounting Location | |
| Windstar | 1999-2004 | PXDP | PXHFD3 | 2.8 ON | | | |
| IMPORTANT FORD APPLICATION INFORMATION | | | | | | | |
| PKDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with factory radios with built-in 6-disc CD changers. Compatible with factory navigation radios. | | | | | | | |
| GMC | Canyon | 2004-2006 | PXDP | PXHGM3 | 1,3.8 ON or 2,3.8 ON | PXHGMTCDD harness is required to retain factory CD Changer (if equipped) | |
| | Envoy | 1999-2001 | PXDP | PXHGM1 | 3.8 ON | | |
| | Envoy | 2002-2007 | PXDP | PXHGM3 | 1,3.8 ON or 2,3.8 ON | | |
| | Denali | 1995-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Denali | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Jimmy | 1998-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Sonoma | 1998-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Safari | 1996-2005 | PXDP | PXHGM1 | 3.8 ON | | |
| | Savana | 1999-2000 | PXDP | PXHGM1 | 3.8 ON | | |
| | Sierra | 1995-2002 | PXDP | PXHGM1 | 3.8 ON | | |
| | Sierra | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Suburban | 1995-2002 | PXDP | PXHGM1 | 3.6 ON | | |
| | Suburban | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | Yukon/XL | 1995-2002 | PXDP | PXHGM1 | 3.6 ON | | |
| | Yukon/XL | 2003-2006 | PXDP | PXHGM3 | 1,3.8 ON | | |
| | IMPORTANT GMC APPLICATION INFORMATION | | | | | | |
| | PKDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PKDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripherals/electronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
|--|------------|-----------|--------|----------------|----------------------|--|
| Honda | Accord | 1998-2002 | PXDP | PXHD1 | 1,4,8 ON | |
| | Accord | 1992-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Civic | 1998-2004 | PXDP | PXHD1 | 1,4,8 ON | |
| | Civic | 1992-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | CRV | 1998-2004 | PXDP | PXHD1 | 1,4,8 ON | |
| | CRV | 1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Del Sol | 1993-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Element | 2002 | PXDP | PXHD1 | 1,4,8 ON | |
| | Insight | 2001-2004 | PXDP | PXHD1 | 1,4,8 ON | |
| | Odyssey | 1995-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | Odyssey | 1998-2004 | PXDP | PXHD1 | 1,4,8 ON | |
| | Passport | 1998-2002 | PXDP | PXHD1 | 1,2,4,8 ON | |
| | Prelude | 1998-2001 | PXDP | PXHD1 | 1,4,8 ON | |
| | Prelude | 1992-1997 | PXDP | PXHCH2 | 1,4,8 ON | |
| | S2000 | 2000-2003 | PXDP | PXHD1 | 1,4,8 ON | |
| | All Models | 2005-2007 | | Not Compatible | | |
| | Accord | 2003-2004 | | Not Compatible | | |
| | Pilot | All Years | | Not Compatible | | |
| | Ridgeline | All Years | | Not Compatible | | |
| | S2000 | 2004 | | Not Compatible | | |
| IMPORTANT HONDA APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with factory radios that have an in dash 6 disk cd changer. Not compatible with navigation radios. | | | | | | |
| Hummer | H2 | 2003-2006 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | Vehicle Specific Notes |
| | H3 | 2005 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | *2003-2005 Must disable factory XM Tuner if equipped |
| IMPORTANT HUMMER APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | |
| Isuzu | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| | Amigo | 1998-2002 | PXDP | PXHTY3 | 1,2,4,8 ON | |
| | Rodeo | 1998-2002 | PXDP | PXHTY3 | 1,2,4,8 ON | |
| | Trooper | 1998-2002 | PXDP | PXHTY3 | 1,2,4,8 ON | |
| IMPORTANT ISUZU APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | |
| Jaguar | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| | S-Type | 2000-2002 | PXDP | PXHFD4 | 2,8 ON | |
| IMPORTANT JAGUAR APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
|--|--|------------|--------|---------|----------------------|---|--|
| Jeep | All Models | 2002-2005 | PXDP | PXHC-H3 | 4.8 ON | Must be non-CANBUS. If radio is an REF, REC, RAQ, RAK series, vehicles are not compatible. *1999 Radios with rounded corners use PXHC-H2 *1999 Radios with square corners use PXHC-H1 | |
| | All Models | 1999*-2001 | PXDP | PXHC-H2 | 4.8 ON | | |
| | All Models | 1995-1999* | PXDP | PXHC-H1 | 1,4.8 ON | | |
| IMPORTANT JEEP APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. To determine if your 2002-2005 vehicle is compatible, factory radio must have "Disk" on preset 1. Vehicle must be non-CANBUS, if radio is an REF, REC, RAQ, RAK series, vehicles are not compatible. The series is indicated on the front of the radio. 1999 Chrysler vehicles have one of two different style radios. These two radios use different harnesses. The shape of the radio face will determine which harness you will use. If your radio face is SQUARE, you will use the harness part# PXHC-H1. If your radio face is OVAL (rounded corners), you will use the harness part# PXHC-H2. | | | | | | | |
| Lincoln | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Aviator | 2002-2003 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Continental | 1998-2004 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Continental | 1995-1997 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Continental* | 1995-1997 | PXDP | PXHF-D1 | 2.8 ON | | |
| | LS | 2000-2003 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Mark VII | 1995-1998 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Navigator | 1999-2003 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Navigator | 1997-1998 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Town Car | 1998-2003 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Town Car | 1995-1997 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Town Car* | 1995-1997 | PXDP | PXHF-D1 | 2.8 ON | *If equipped with JBL, use PXHF-D1 at Rear Control Unit in trunk | |
| | IMPORTANT LINCOLN APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with factory radios with built-in 6-disc CD changers. Compatible with factory navigation radios. | | | | | | | |
| Mazda | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | B-series Truck | 1998-2001 | PXDP | PXHF-D3 | 2.8 ON | | |
| | B-series Truck | 1997 | PXDP | PXHF-D2 | 2.8 ON | | |
| IMPORTANT MAZDA APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | | |
| Mercury | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Cougar | 1999-2004 | PXDP | PXHF-D4 | 1,2.8 ON | | |
| | Grand Marquis | 1998-2003 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Grand Marquis | 1995-1997 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Grand Marquis | 1995-1997 | PXDP | PXHF-D1 | 2.8 ON | | |
| | Mountaineer | 1998-2004 | PXDP | PXHF-D3 | 2.8 ON | | |
| | Mountaineer | 1995-1997 | PXDP | PXHF-D2 | 2.8 ON | | |
| | Mountaineer | 1995-1997 | PXDP | PXHF-D1 | 2.8 ON | | |
| | Sable | 1996-2005 | PXDP | PXHF-D1 | 2.8 ON | | |
| | Tracer | 1995-2004 | PXDP | PXHF-D1 | 2.8 ON | | |
| | Villager | 1999-2002 | PXDP | PXHF-D3 | 2.8 ON | | |
| | IMPORTANT MERCURY APPLICATION INFORMATION | | | | | | |
| | PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with factory radios with built-in 6-disc CD changers. Compatible with factory navigation radios. | | | | | | |
| Nissan | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Quest | 1999-2002 | PXDP | PXHF-D3 | 2.8 ON | | |
| IMPORTANT NISSAN APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | | |
| *Dip Switch Settings: Please See Product Instructions for Dip Switch Configuration Settings | | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
|--|--|-----------|----------------|---------|----------------------|---|--|
| Oldsmobile | Achieva | 1996-1998 | PXDP | PXHGM3 | 1,3,8 ON | Trunk/CD Changer Mounting Location | |
| | Alero | 2003-2004 | PXDP | PXHGM3 | 2,3,8 ON | | |
| | Alero | 1999-2000 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Aurora | 2001-2004 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Aurora | 1995-1999 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Bravada | 2004 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | | |
| | Bravada | 1997-2001 | PXDP | PXHGM1 | 3,8 ON | | |
| | Cutlass | 1997-1999 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Cutlass Supreme | 1995-1997 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Eighty-Eight | 1996-1999 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Intrigue | 1998-2001 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | LSS | 1996-1999 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Regency | 1997-1998 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Silhouette | 2004 | PXDP | PXHGM3 | 2,3,8 ON | | |
| | Silhouette | 1996-1999 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | IMPORTANT OLDSMOBILE APPLICATION INFORMATION | | | | | | |
| | PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PXDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripheralelectronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | |
| Plymouth | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | All Models | 1995-2000 | PXDP | PXHCH1 | 1,4,8 ON | All models must have "Disc ^" printed on Preset Button # 1. | |
| | Neon | 2002-2004 | PXDP | PXHGM3 | 1,4,8 ON | | |
| IMPORTANT PLYMOUTH APPLICATION INFORMATION | | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | | |
| Pontiac | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes | |
| | Aztec | 2003-2005 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | | |
| | Bonneville | 2000-2005 | PXDP | PXHGM2 | 3,8 ON | Trunk Mounting Location | |
| | Bonneville | 1996-1999 | PXDP | PXHGM1 | 3,8 ON | | |
| | Firebird / Trans Am | 1996-2002 | PXDP | PXHGM1 | 3,8 ON | | |
| | Grand AM | 2003-2005 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | | |
| | Grand AM | 1996-2000 | PXDP | PXHGM1 | 3,8 ON | | |
| | Montana | 2004-2005 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | | |
| | Montana | 1999-2000 | PXDP | PXHGM1 | 3,8 ON | | |
| | Sunfire | 2003-2005 | PXDP | PXHGM3 | 1,3,8 ON | | |
| | Sunfire | 1996-1999 | PXDP | PXHGM1 | 3,8 ON | | |
| | TransSport | 1996-1998 | PXDP | PXHGM1 | 3,8 ON | | |
| | Vibe | 2004-2005 | PXDP | PXHGM3 | 1,3,8 ON or 2,3,8 ON | | |
| | G6 | 2005 | Not Compatible | | | | |
| | Grand Prix | 2004-2007 | Not Compatible | | | | |
| | IMPORTANT PONTIAC APPLICATION INFORMATION | | | | | | |
| | PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. GM vehicles 1998 - 2004 not equipped with a factory slave may not be able to support an external device. Therefore the PXDP may not be compatible. If you are an experienced installer, you can retain XM. Please follow this link to the Tech Brief to retain XM: http://peripheralelectronics.com/web/tech_dept.asp . 1995-1999 Radios with built in CD player (Except Corvette) are NOT compatible because they do not have CD changer control functions. | | | | | | |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
|--|---|-----------|--------|-------------------|----------------------|---|
| Saturn | All Models | 1995-1999 | PXDP | PXHGM1 | 3,8 ON | |
| | IMPORTANT SATURN APPLICATION INFORMATION | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | |
| Scion | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| | tC | 2003-2007 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | xA | 2003-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | xB | 2003-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| IMPORTANT SCION APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. | | | | | | |
| Toyota | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| | 4Runner | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | 4Runner | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Avalon | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Avalon | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Camry | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Camry | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Corolla | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Corolla | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Corolla | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Echo | 2000-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Highlander | 2001-2004 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Highlander | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Land Cruiser | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Land Cruiser | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Matrix | 2003-2004 | PXDP | PXHGM3 | 1,3,8 ON | |
| | Matrix | 2005-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | MR2 | 2000-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | RAV4 | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Sequoia | 2001-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Sequoia | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Sienna | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |

| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
|---|------------|----------------|----------------|-------------------|----------------------|---|
| Toyota | Sienna | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Solara | 1999-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Solara | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Supra | 1998 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | T100 | 1998 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Tacoma | 1998-2005 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Tacoma | 2006-2007 | PXDP | PXHTY3 or PXH2TY1 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Tercel | 1998 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Tundra | 2000-2007 | PXDP | PXHTY3 | 1,2,4,8 ON | When using the PXHTY3 the green wires must be cut on the PXHTY3 harness |
| | Prius | All Years | Not Compatible | | | |
| Highlander | 2008 | Not Compatible | | | | |
| IMPORTANT TOYOTA APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. When using the PXHTY3 with 2006-2007 vehicles the green wires must be cut on the PXHTY3 harness. Fully compatible with factory installed Toyota Navigation Systems. Not compatible with Hybrid vehicles. | | | | | | |
| Make | Model | Year | Part # | Harness | Dip Switch Settings* | Vehicle Specific Notes |
| Volkswagen | All Models | 1998-2006 | PXDP | PXHWW1 | 1,8 ON | Trunk Mounting Location |
| | All Models | 1998-2006 | PXDP | PXHWW2 | 1,8 ON | For use with Single DIN radios |
| | All Models | 2003-2006 | PXDP | PXHWW3 | 1,8 ON | For use with Double DIN radios |
| IMPORTANT VOLKSWAGEN APPLICATION INFORMATION | | | | | | |
| PXDP: Not compatible with any factory external audio source such as: XM tuner, CD changer, or Cassette player. These devices must be disconnected during the installation and will no longer function. Not compatible with vehicles equipped with a factory Navigation system. When possible, we recommend using the PXHWW2 or PXHWW3 harness and install the PXDP behind the radio. This will avoid the possibility of inherent noise problems with the factory VW CD changer cable that is found in some vehicles. Double DIN (4" Tall) VW radios require the PXHWW3 to connect behind the radio. | | | | | | |
| PXHWW3: When using the PXHWW3 harness, connect the loose black lead to suitable chassis ground. If equipped with factory satellite, remove the blue OEM sub harness from the main OEM harness to plug in the PXHWW3 harness. | | | | | | |

 simple[®]
www.isimplesolutions.com

iSimple Solutions[®],
a division of AAMP of America[™]
13160 56th Court Clearwater, Florida 33760
Ph. 866-788-4237
support@isimplesolutions.com
©2009 AAMP of Florida, Inc.



**For Best Performance Have It
Professionally Installed.**

